




Ein Geschäftsbereich von Schmid & Wezel

Spare parts list

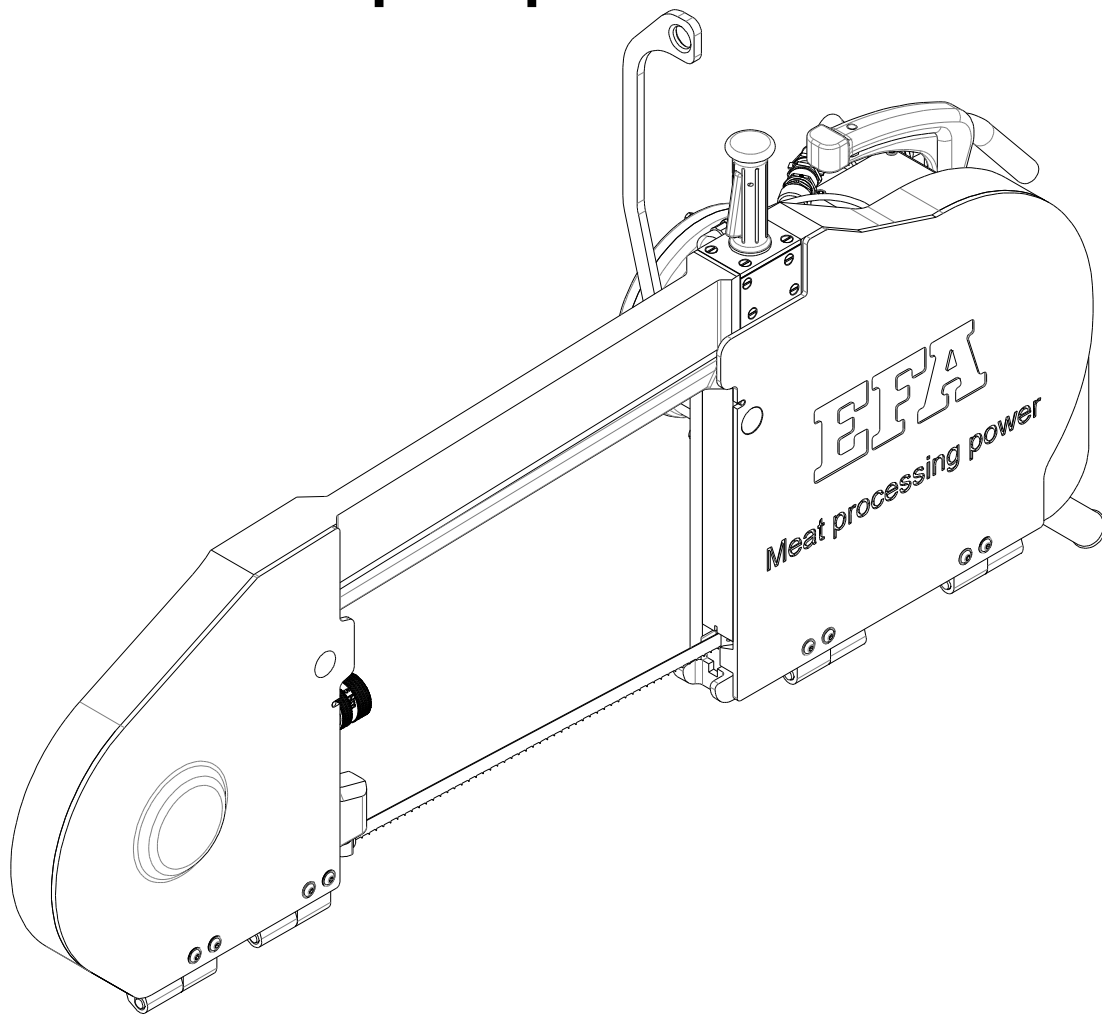

**Splitting saw SB 327 E 400 V 50 Hz
110891013**

Schmid und Wezel GmbH

Maschinenfabrik

Maybachstrasse 2

D-75433 Maulbronn

Tel. +49 7043 1020

Fax +49 7043 10278

E-mail: efa-verkauf@efa-germany.de

www.efa-germany.com


Spare parts list splitting saw SB 327 E 400 V 50 Hz (110891013)

 Splitting saw SB 327 E 400 V 50 Hz (110891013)			
Item no.	Part number	Part description	Quantity
1	003014564	Housing	1
2	008016153	Geared motor cpl.	1
3	001317006	Spring washer	4
4	001325916	Hexagon screw	4
5	003009272	Guide pulley, rear	1
6	003013794	Spacer ring	1
7	003009246	Hexagon nut	1
8	007009273	Guide pulley, front cpl.	1
9	003013796	Bearing bolt	1
10	003006939	Guide ledge	2
11	001325914	Hexagon screw	14
12	001317003	Spring washer	16
13	003006436	Guide ledge	2
14	003012583	Guide plate	1
15	001312432	Retaining ring	1
16	007014662	Ledge, front cpl.	1
17	003012587	Stop bracket	1
18	001317002	Spring washer	1
19	001325913	Hexagon screw	1
20	001326412	Countersunk screw	2
21	007012585	Torque wrench cpl.	1
22	003014383	Sensor base, front	1
23	001317714	O-ring	1
24	001601227	Inductive sensor	2
25	001326404	Countersunk screw	4
26	001326019	Cylinder head screw	8
27	001368634	Sealing plug	8
28	001605028	Terminal	8
29	002000306	Magnetic clamp system	2
30	007009235	Bracket cpl.	2
31	007014661	Ledge, rear cpl.	1
32	003014384	Sensor base, rear	1
33	001317705	O-ring	1
34	003012594	Cover plate	1
35	001326406	Countersunk screw	8
36	003012593	Seal	2
37	007014643	Handle cpl.	1
38	001971199	Saw belt	1
39	001368626	Screw plug	1
40	001610661	Swivel connection	2
41	007014444	Suspension cpl.	1
42	003013454	Sealing screw	2
43	001601780	Line, complete	1
44	003009270	Water pipe	1
45	003009271	Water pipe	1
46	007009835	Lever cpl.	2
47	003014565	Fixed hinge	4
	007014571	Cover, front, complete (Pos. 48, 60 & 61)	1
48	003014571	Cover, front	1
	007014570	Cover, rear, complete (Pos. 48, 60 & 61)	1


Spare parts list splitting saw SB 327 E 400 V 50 Hz (110891013)

49	003014570	Cover, rear	1
50	003015327	Hinge	4
51	001317605	Washer	6
52	001328005	Fillister head screw	2
53	001328004	Fillister head screw	8
54	001325596	Elbow union	1
55	001325556	Cable gland	1
56	001605039	Terminal	1
58	003015319	Bolt	4
59	001326900	Screw, hexagon head flanged	4
50	003015327	Hinge	4
51	001317605	Washer	6
52	001328005	Fillister head screw	2
53	001328004	Fillister head screw	8
54	001325596	Elbow union	1
55	001325556	Cable gland	1
56	001605039	Terminal	1
58	003015319	Bolt	4
59	001326900	Screw, hexagon head flanged	4
60	003016141	Washer	2
61	003009237	Washer	2
Accessories, included in scope of supply			
	007899712	Accessories	

Spare parts list splitting saw SB 327 E 400 V 50 Hz (110891013)

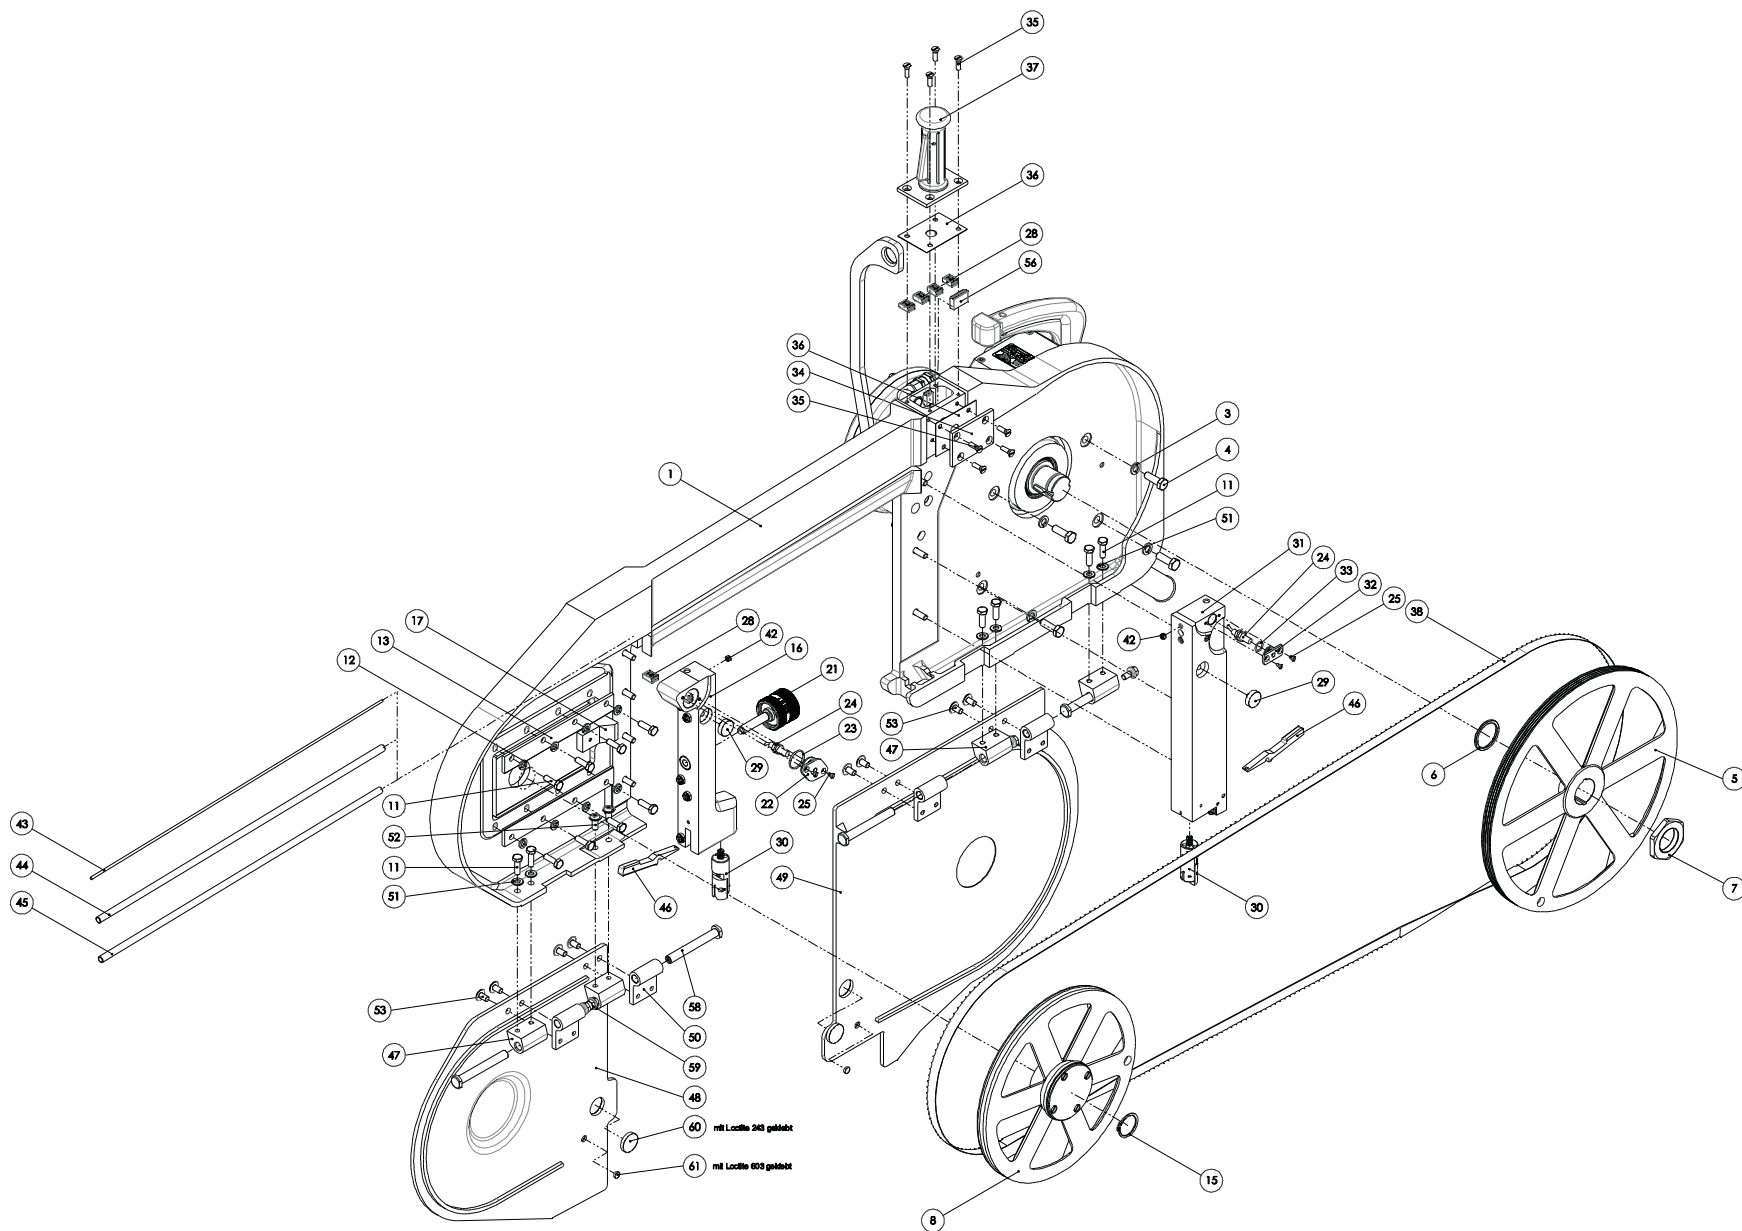


Spare parts list splitting saw SB 327 E 400 V 50 Hz (110891013)

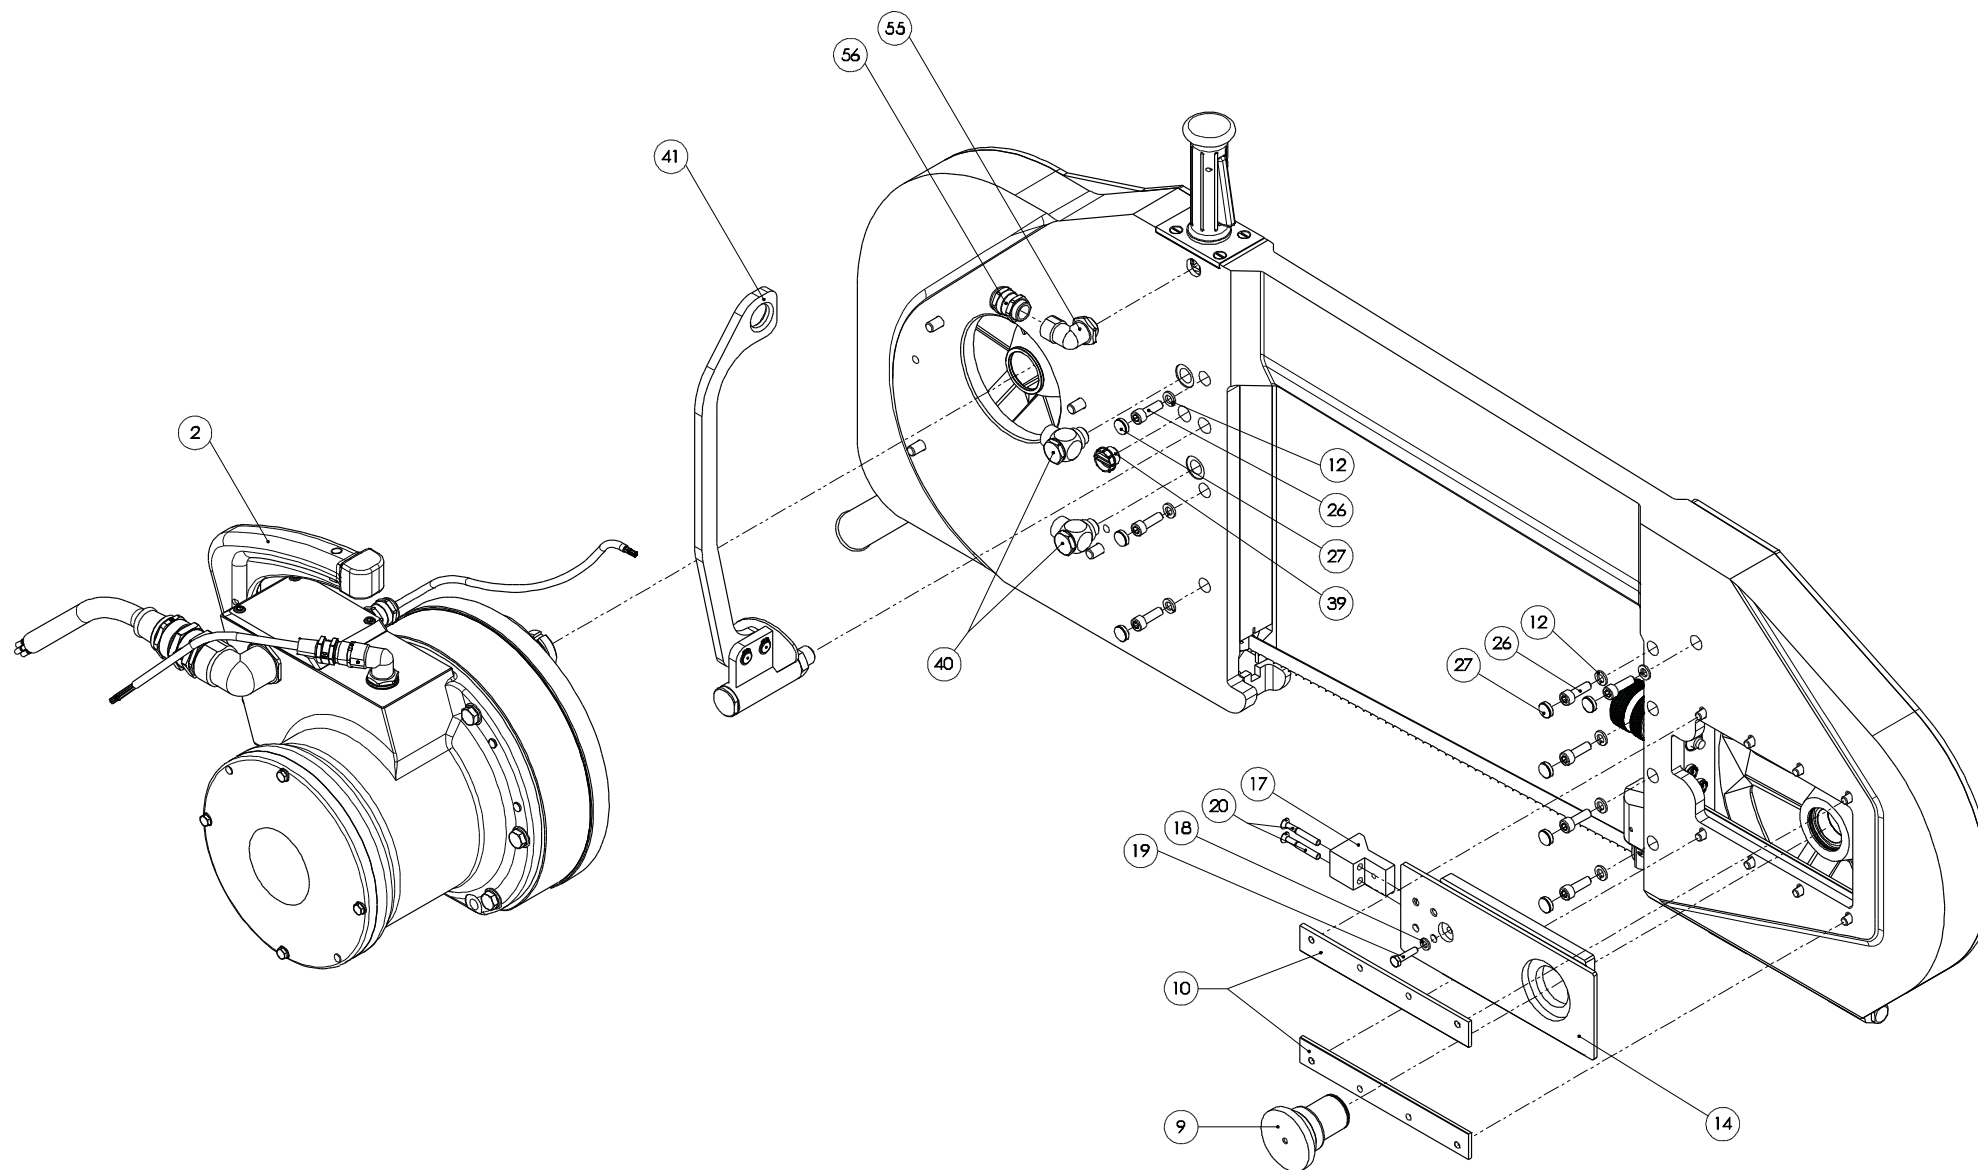

Spare parts list splitting saw SB 327 E 400 V 50 Hz (110891013)

 Spare parts list for motor assembly cpl. (008016153)			
Item no.	Part number	Part description	Quantity
1	001326029	Cylinder head screw	6
2	001317003	Spring washer	6
3	003007196	Gear unit cover	1
4	001344109	Shaft sealing ring	1
5	003007217	Drive shaft	1
6	001305415	Feather key	2
7	001340299	Deep-groove ball bearing	1
8	001305461	Feather key	1
9	001312365	Retaining ring	1
10	001312440	Retaining ring	1
11	003007651	Gear wheel	1
12	001340217	Deep-groove ball bearing	1
13	001601718	Line, complete	1
14	001314607	Wave lock washer	1
15	001325556	Cable gland	1
16	001604016	Reducing ring	1
17	003003177	Seal	1
18	001368611	Blanking plug	1
19	001368635	Blanking plug	1
20	003003178	Cover	1
21	001326013	Cylinder head screw	4
22	001605028	Terminal	6
23	001605029	Terminal	5
24	001604019	Reducing ring	1
25	001325597	Elbow union	1
26	001352109	Bend protection	1
27	001325598	Cable gland	1
28	001601814	Line, complete	1
29	001305560	Cylindrical pin	2
30	007014448	Motor	1
31	002000328	Vent screw	2
32	003007630	Seal	1
33	001317002	Spring washer	4
34	001325913	Hexagon screw	4
35	001317007	Spring washer	1
36	001326101	Cylinder head screw	1
37	001605601	Terminal	1
38	001304613	Hexagon nut	1
39	001326215	Grub screw	1
40	001307217	Cylindrical pin	1
41	001362674	Compression spring	1
42	001601227	Inductive sensor	1
43	003007198	Operating lever	1
44	003009350	Switching handle	1
45	001300124	Hexagon nut	1
46	001326206	Grub screw	1
47	001368605	Sealing plug	4
48	001368617	Intermediate plug	2
49	001312672	O-ring	1


Spare parts list splitting saw SB 327 E 400 V 50 Hz (110891013)

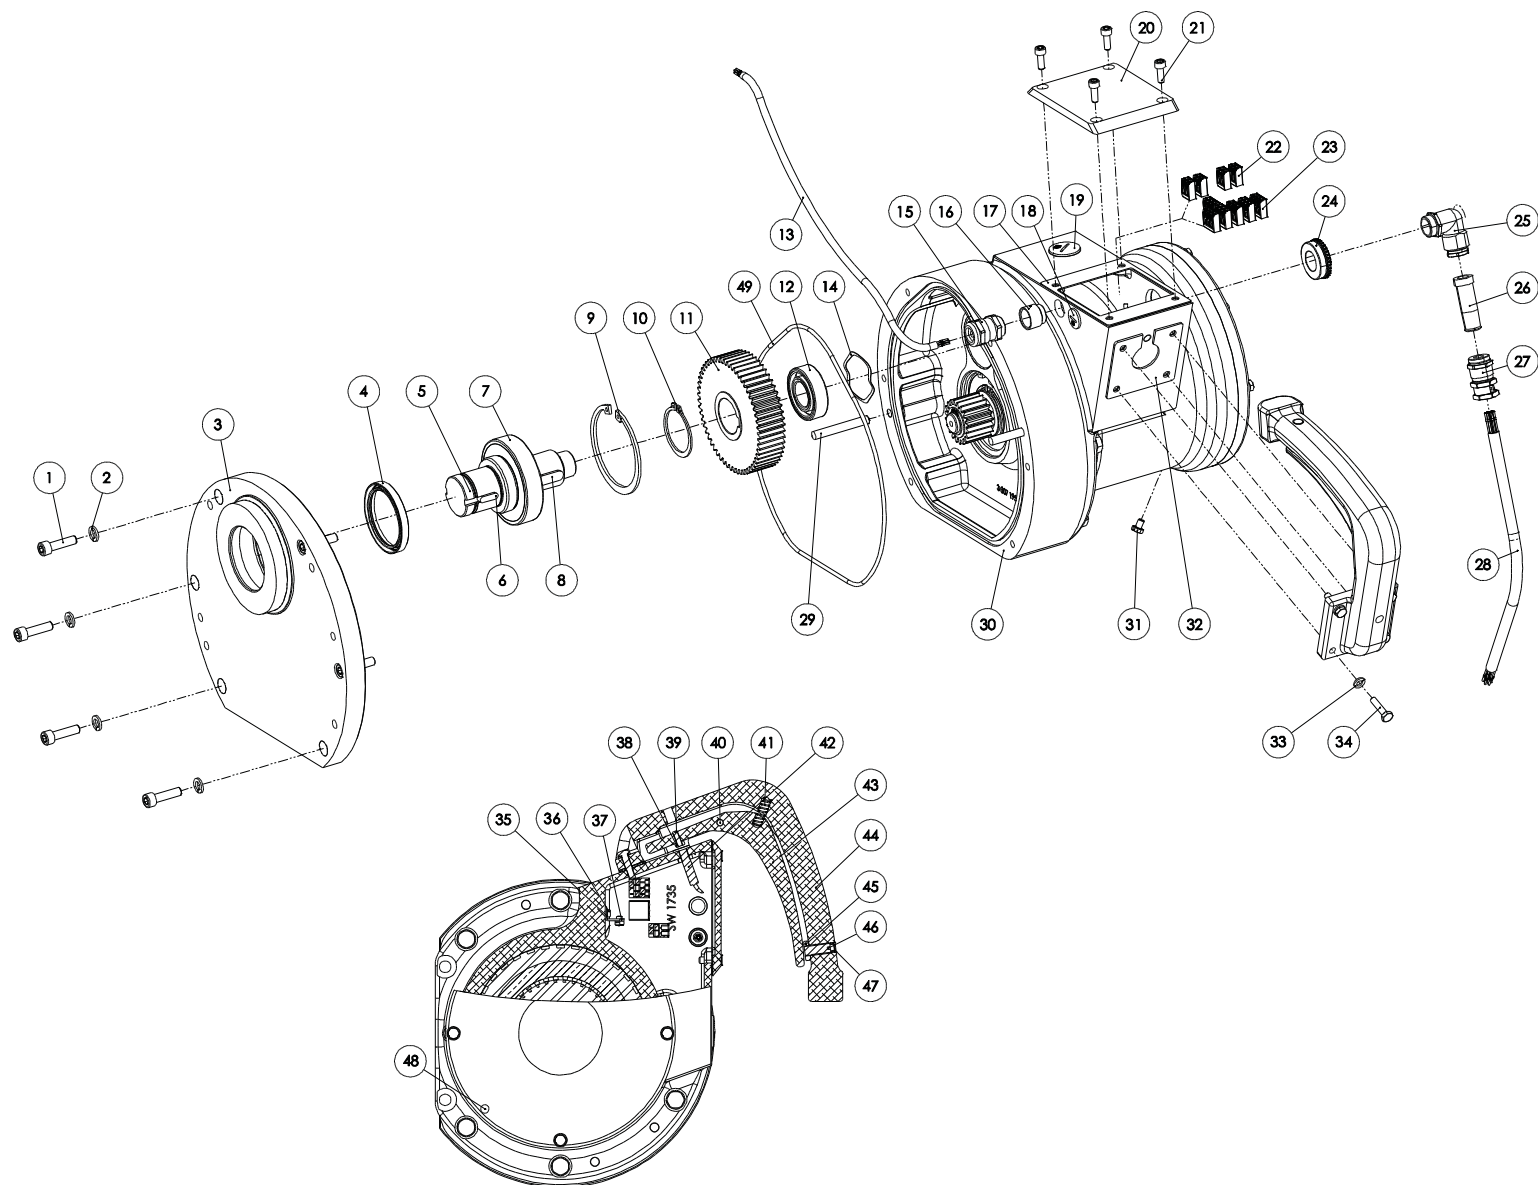

Spare parts list splitting saw SB 327 E 400 V 50 Hz (110891013)


 Spare parts list for motor assembly (007014448)			
Item no.	Part number	Part description	Quantity
10	001305415	Feather key	1
20	001312365	Retaining ring	1
30	001312417	Retaining ring	1
40	001312440	Retaining ring	1
50	001312689	O-ring	1
60	001314612	Wave lock washer	1
70	001317002	Spring washer	4
80	001317006	Spring washer	5
90	001325913	Hexagon screw	4
100	001325916	Hexagon screw	5
110	001340298	Deep-groove ball bearing	1
120	001340299	Deep-groove ball bearing	1
130	001344109	Shaft sealing ring	1
140	003007195	Gear unit housing	1
150	003007650	Gear wheel	1
160	007014447	Stator housing cpl.	1
170	007006009	End shield cpl.	1
180	007007218	Rotor shaft cpl.	1

Spare parts list splitting saw SB 327 E 400 V 50 Hz (110891013)

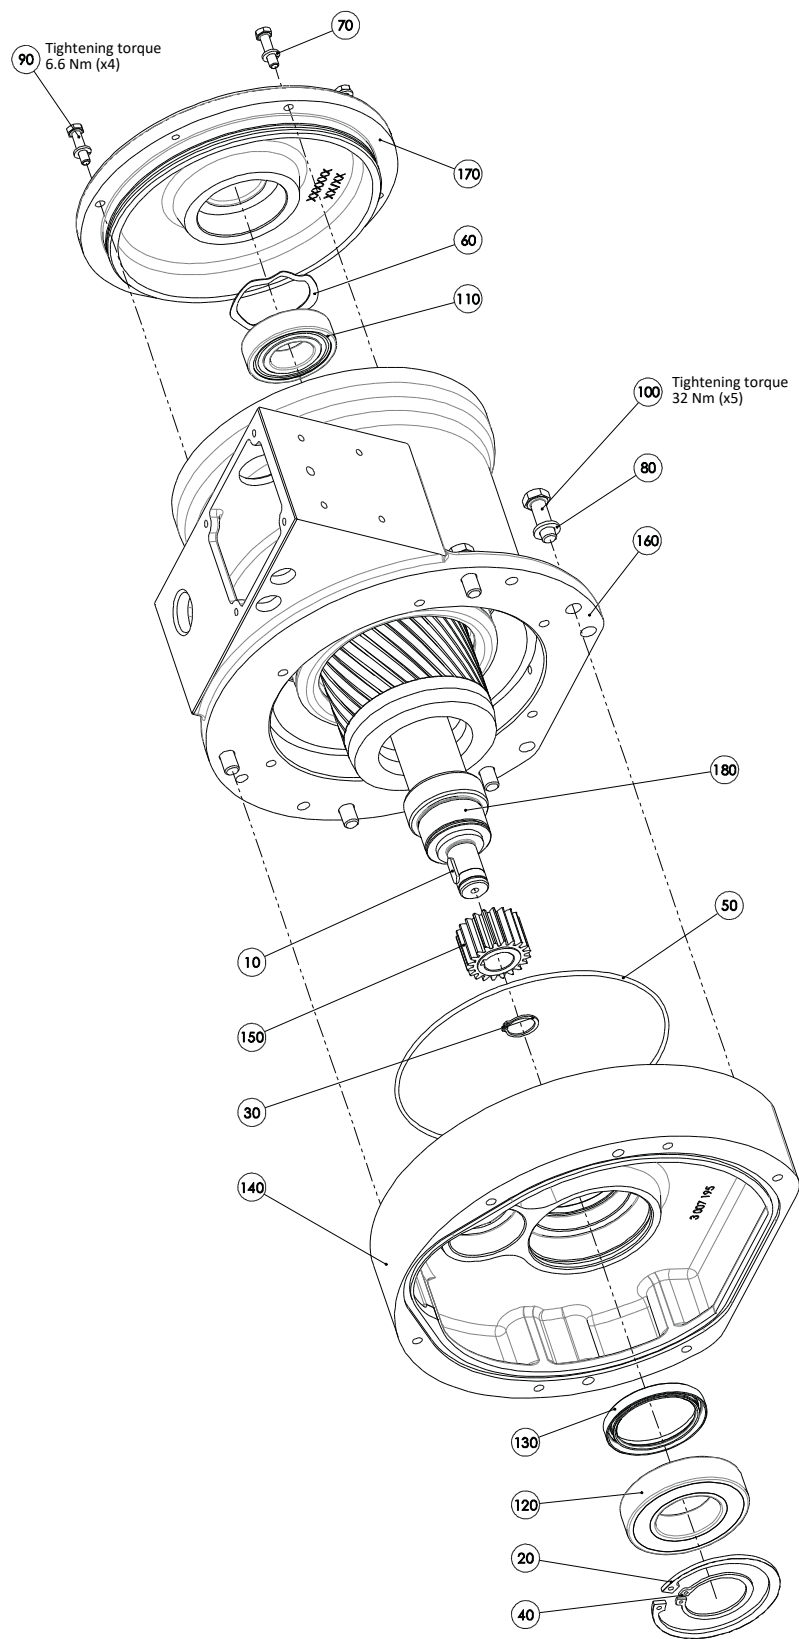


Spare parts list splitting saw SB 327 E 400 V 50 Hz (110891013)

 Spare parts list for bracket assembly (007009235)			
Item no.	Part number	Part description	Quantity
1	001326118	Cylinder head screw	2
2	001326302	Grub screw	1
3	001362674	Compression spring	1
4	002000259	HM plate	1
5	003009235	Bracket	1
6	003009255	HM guide	2
7	003009634	Fibre guide	1

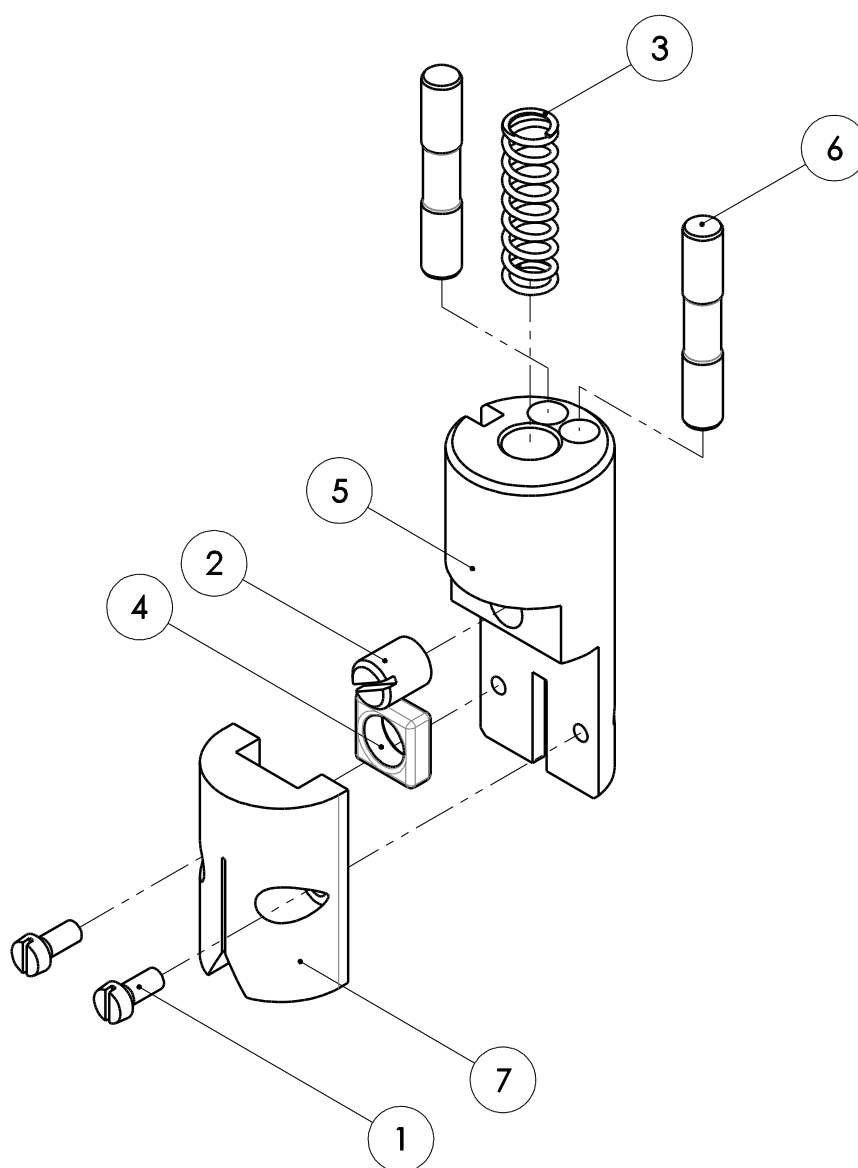


Spare parts list splitting saw SB 327 E 400 V 50 Hz (110891013)

 Spare parts list for switching handle cpl. (007014643)			
Item no.	Part number	Part description	Quantity
1	003014643	Switching handle	1
2	003014527	Operating lever	1
3	001601227	Inductive sensor	1
4	001318322	Compression spring	1
5	001307225	Cylindrical pin	1
6	001312644	O-ring	1
7	001326420	Countersunk screw	4
8	003014376	Switch-handle plate	1

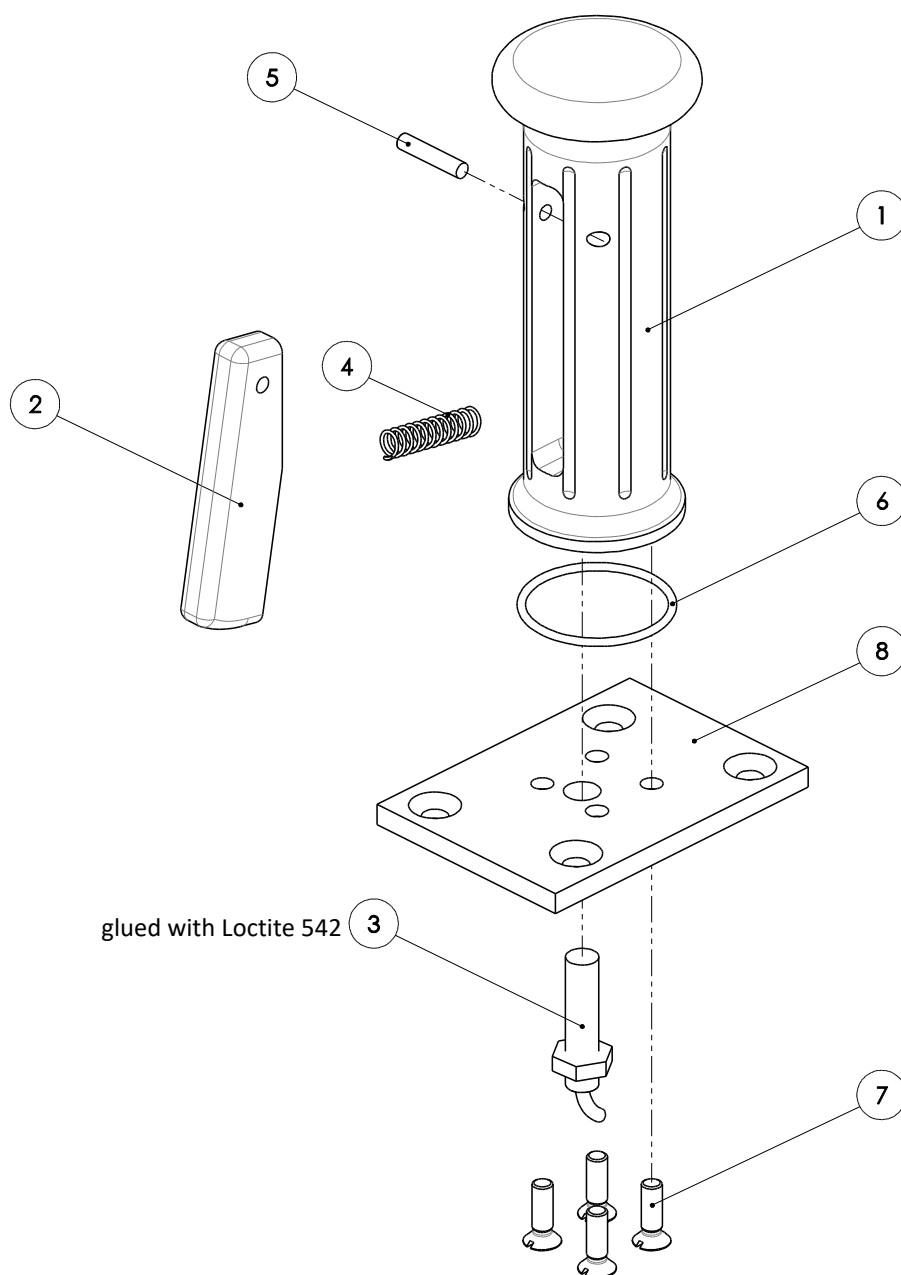


Spare parts list splitting saw SB 327 E 400 V 50 Hz (110891013)

 Spare parts list for ledge, front cpl. (007014662)			
Item no.	Part number	Part description	Quantity
1	003014378	Ledge, front	1
2	001306409	Cylindrical pin	1
3	001307217	Cylindrical pin	1
4	001312616	O-ring	1
5	001312656	O-ring	1
6	001312662	O-ring	2
7	001321806	Grub screw	1
8	001342506	Ball	1
9	001342510	Ball	2
10	001610223	Full-cone nozzle	5
11	002000297	Grub screw	1
12	003012584	Threaded bush	1

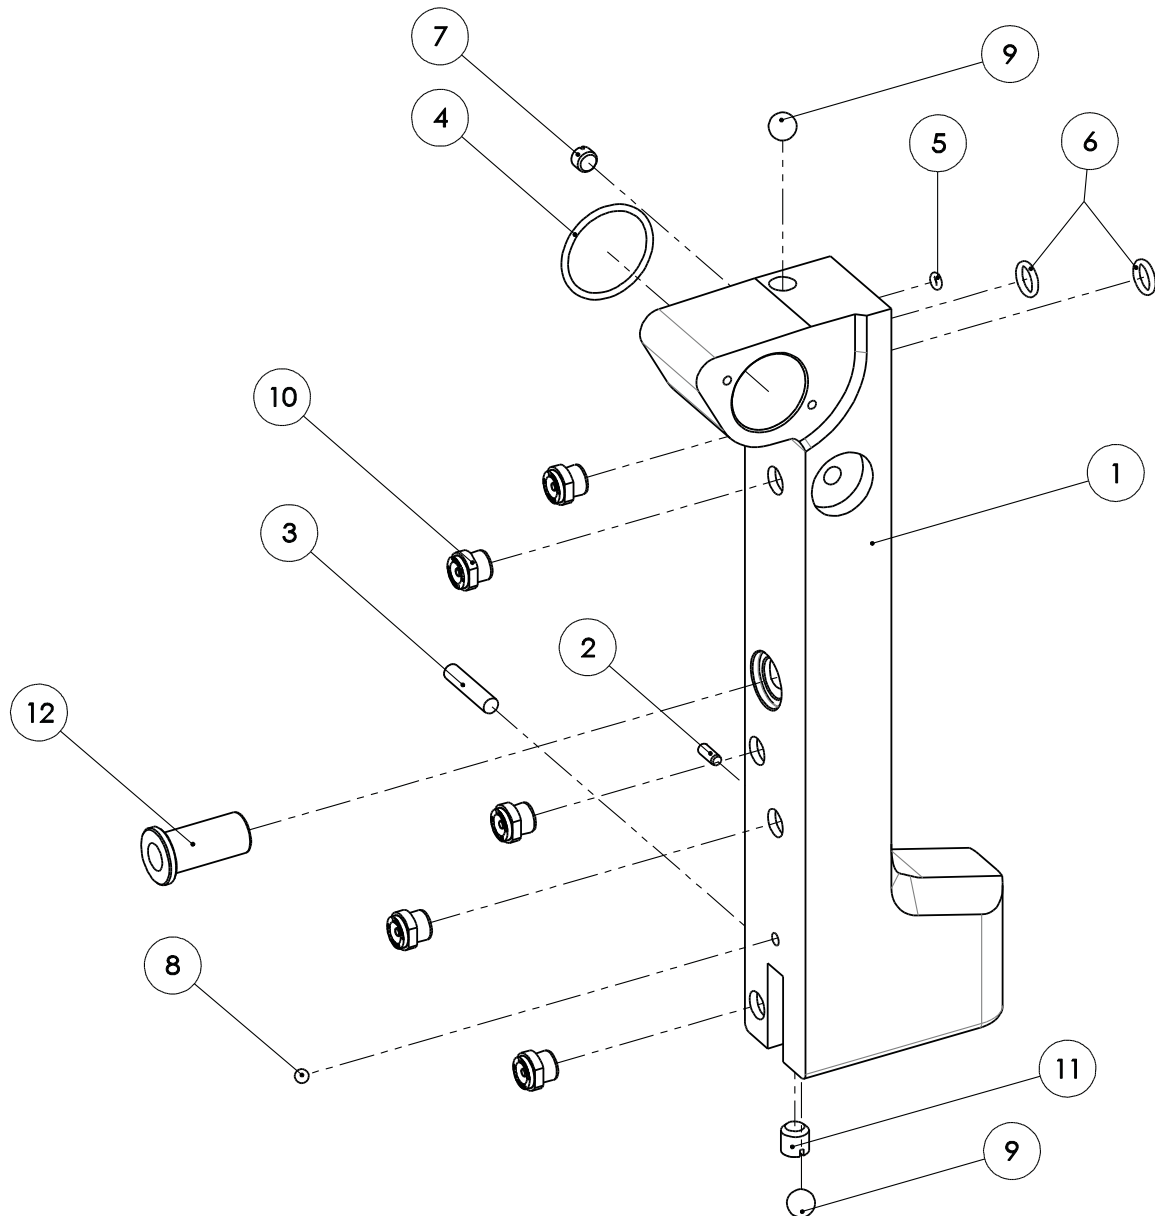


Spare parts list splitting saw SB 327 E 400 V 50 Hz (110891013)

 Spare parts list for ledge, rear cpl. (007014661)			
Item no.	Part number	Part description	Quantity
1	003014377	Ledge, rear	1
2	001610223	Full-cone nozzle	9
3	001306428	Cylindrical pin	1
4	001307217	Cylindrical pin	1
5	001307223	Cylindrical pin	1
6	001312624	O-ring	1
7	001312649	O-ring	2
8	001312656	O-ring	1
9	001312662	O-ring	2
10	001342506	Ball	1
11	001342510	Ball	1
12	002000296	Grub screw	1
13	002000297	Grub screw	1
14	002000298	Grub screw	2

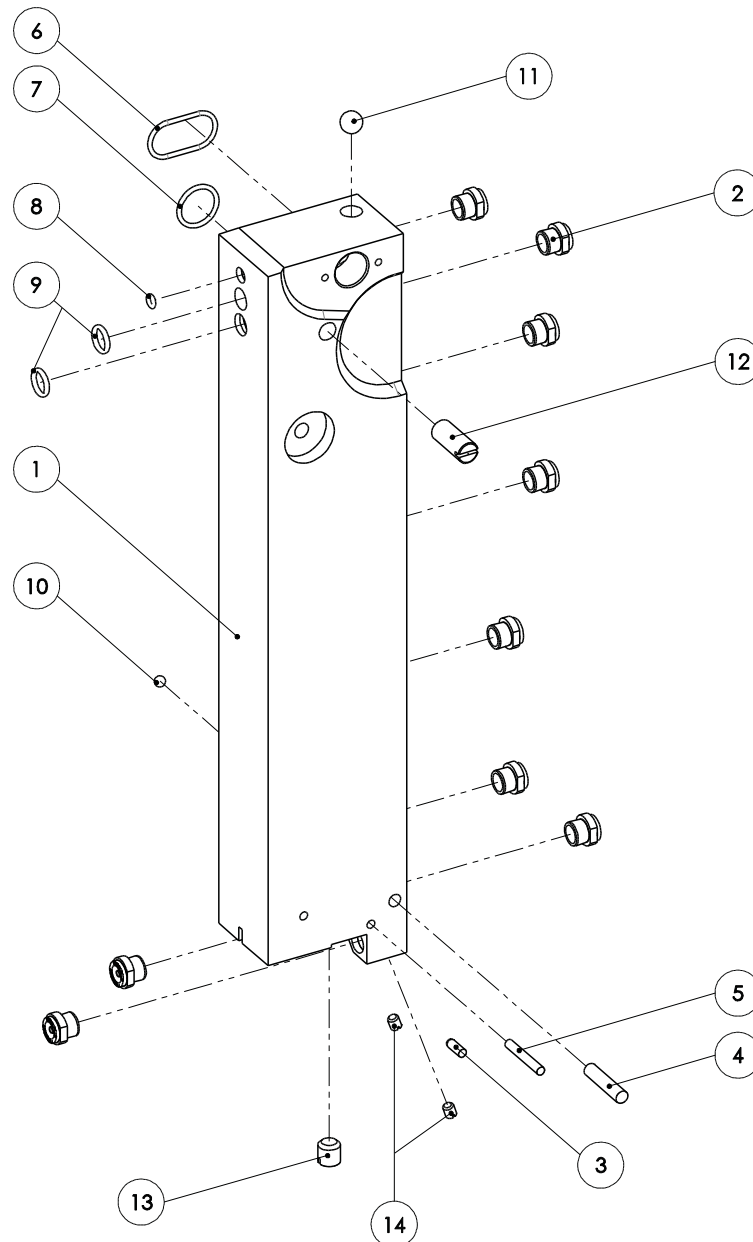


Spare parts list splitting saw SB 327 E 400 V 50 Hz (110891013)

 Spare parts list for guide pulley, front cpl. (007009273)			
Item no.	Part number	Part description	Quantity
1	003009273	Guide pulley, front	1
2	001344236	Sealing ring	1
3	001345330	Deep-groove ball bearing	2
4	003006725	Spacer ring	1
5	003006724	Spacer ring	1
6	003009238	Cover	1
7	001326402	Countersunk screw	4

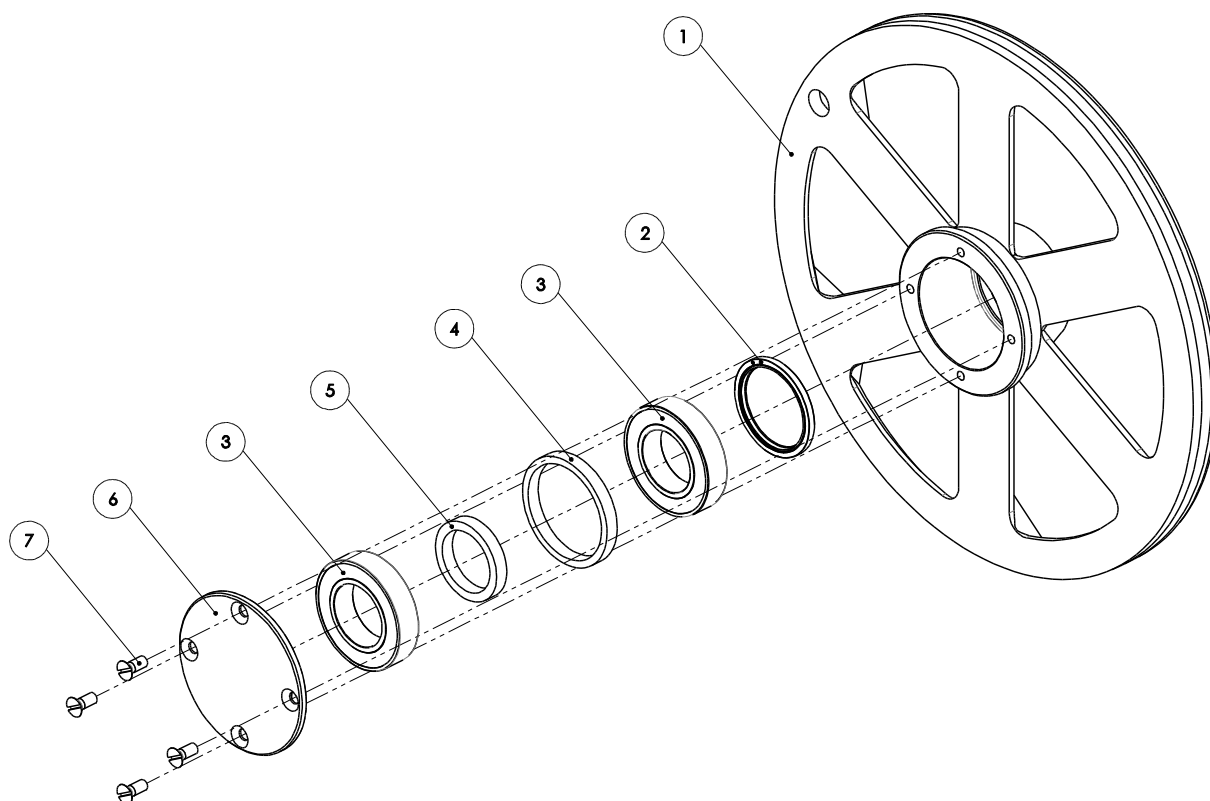

Spare parts list splitting saw SB 327 E 400 V 50 Hz (110891013)

EFA Ein Geschäftsbereich von Scheuch & Knecht Spare parts list for suspension cpl. (007014444)			
Item no.	Part number	Part description	Quantity
1	003014444	Sleeve cpl.	1
2	003010851	Threaded bolt	1
3	001300248	Hexagon nut	1
4	003006381	Bolt	2
5	001317909	Retaining ring	2
6	003014443	Suspension lever	1

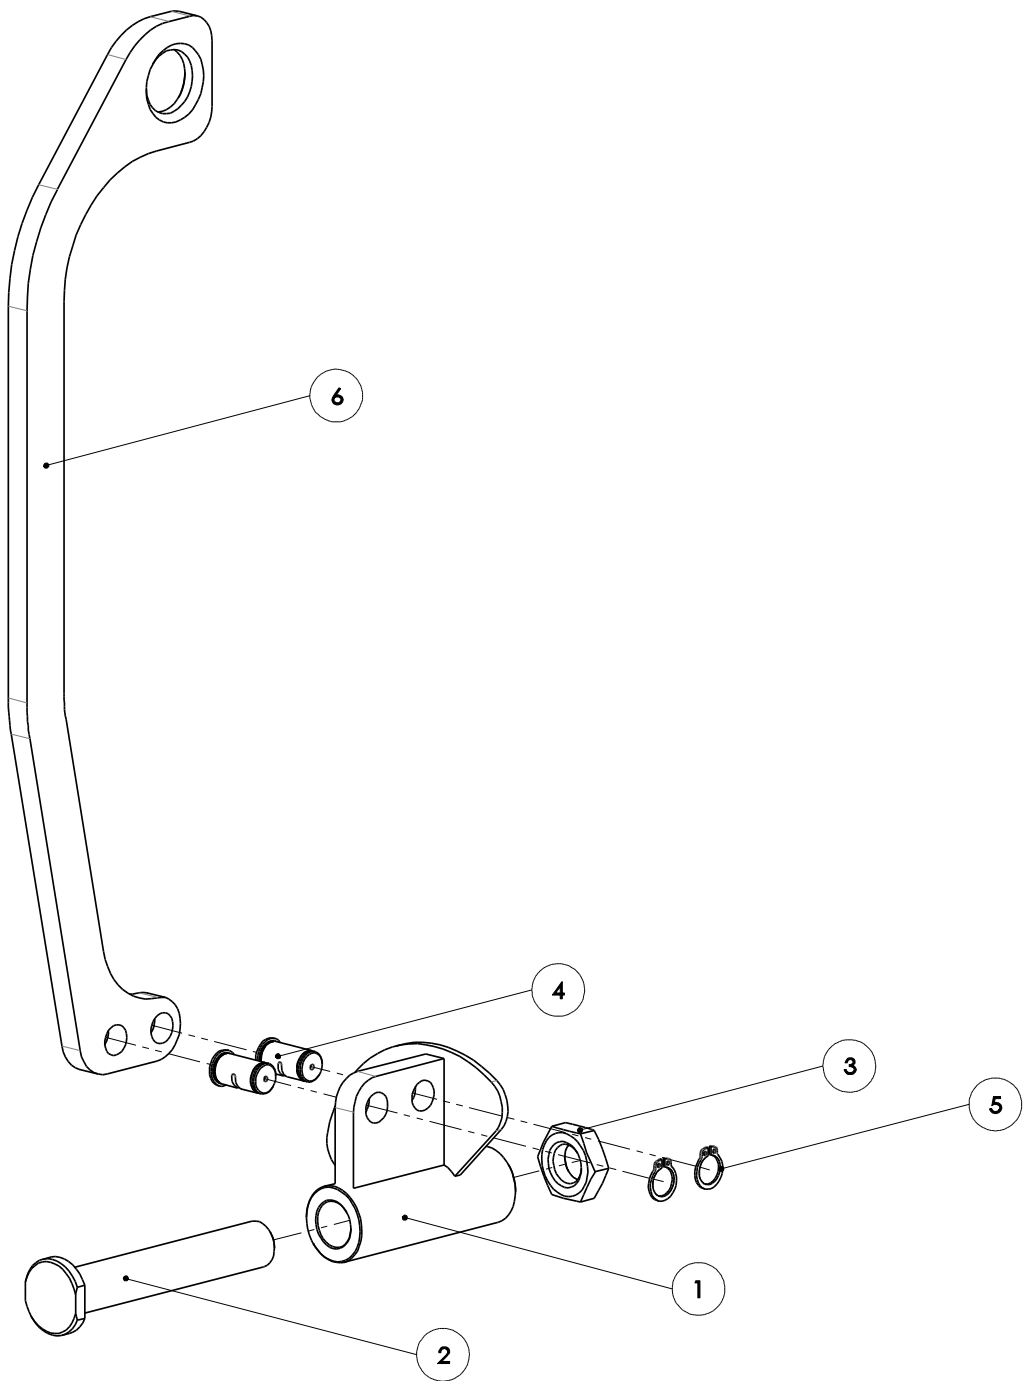

Spare parts list splitting saw SB 327 E 400 V 50 Hz (110891013)

